

# Change Bulletin

No: CB029

Rev: Draft1

Date: 29 March 2008



Tesco Corporation  
6204 – 6A Street SE  
Calgary, AB. T2H 2B7  
Phone: (403) 692 5700  
[www.tescocorp.com](http://www.tescocorp.com)

## Description: Charge Filter re-plumbing

### BACKGROUND INFORMATION:

According to feed back from commissioning and engineering investigation it was revealed that unfiltered oil gets into the swash pump controller of a D4P power unit. Affected products are the D4P power units for HCI and HXI top drive systems.


### AFFECTED PRODUCT:

The information contained in this bulletin applies for the following Tesco products:  
#730612- Kit, Charge Filter, D4P  
Reference ECN-s 111-0074

### DESCRIPTION OF CHANGE:

Move quick connect for pilot control from IN port to OUT port of the charge filter.

*J. O'Brien*  
*June 2, 2008*

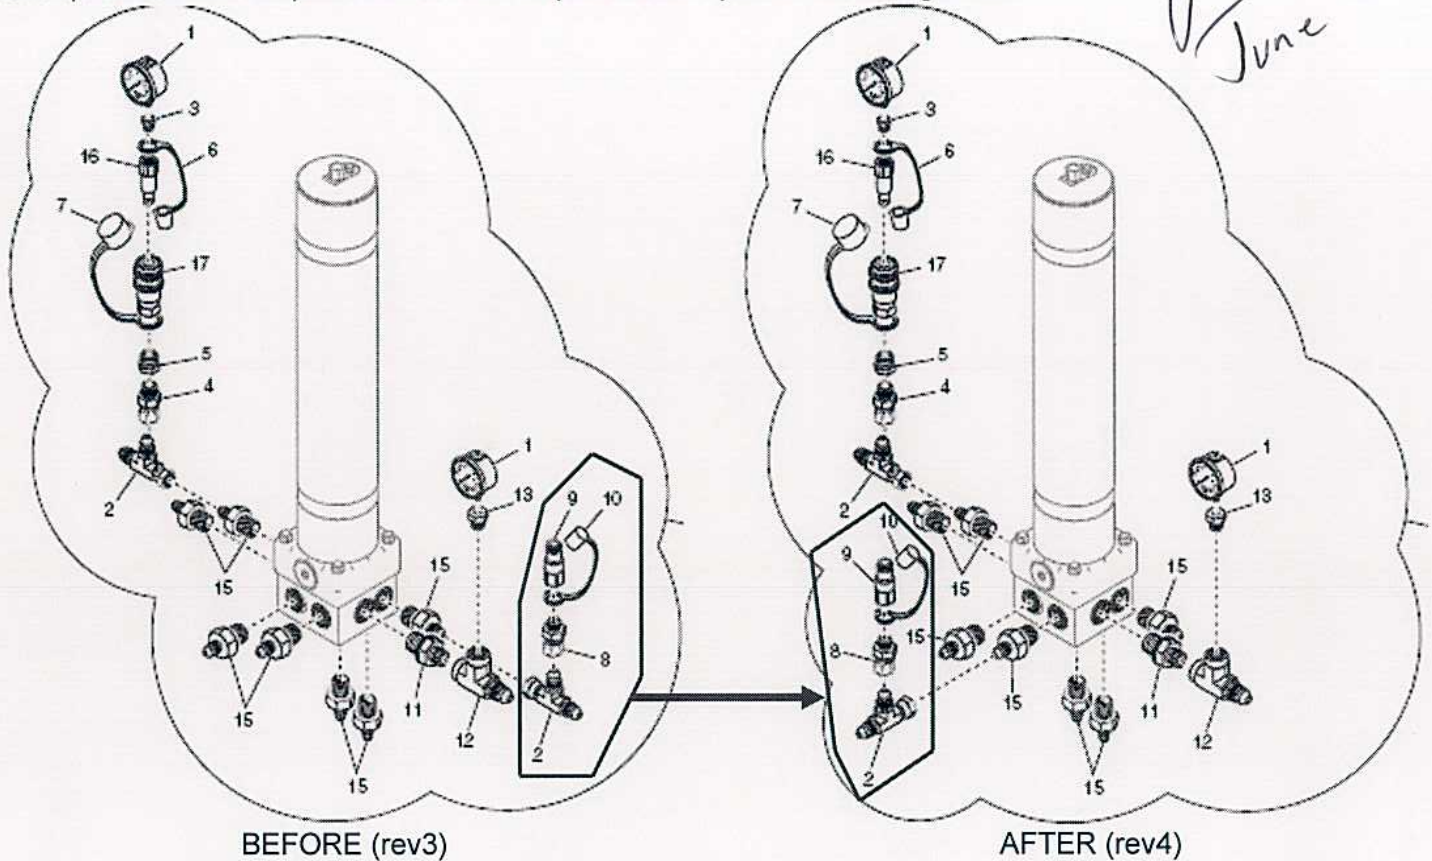

### ACTION REQUIRED:

Plumb according to new rev 4 level of illustration I-730612 (detail shown above).  
Hose kit connections to the charge filter (see I-730770) do not change.

Contact your local TESCO Parts and Service Center for further information regarding this bulletin and or supply of affected components noted above.