


Change Bulletin			 <p>Tesco Corporation 6204 – 6A Street SE Calgary, AB. T2H 2B7 Phone: (403) 692 5700 www.tescocorp.com</p>
No: CB030	Rev: 0	Date: 29 Dec 2008	
Description: Replace Nylon Locknut with Stover Locknut on EMI400 Torque Restraint			

BACKGROUND INFORMATION:

It came to Tesco’s attention that in some instances the special bolts used to mount UHMW liners to torque restraint may not have enough threads protruding through the nylon locknuts. ECN-141-0086 updated the bill of materials to use Stover locknut (Tesco#1410105) instead of nylon locknut (Tesco# 4333).



Acceptable
At least 2 threads
Protruding through nylon

Not Acceptable
Not enough thread
protruding through nylon

AFFECTED PRODUCT:

- #970088 Assembly, Torque Restraint, EMI400, Ensign US Drilling
- #970069 Assembly, Torque Restraint, EMI400, H&P
- #920028 Assembly, Torque Restraint, EMI400, H&P

DESCRIPTION OF CHANGE:

Nylon locknut (Tesco# 4333) was replaced with Stover locknut (Tesco# 1410105)

ACTION REQUIRED:

Nylon locknuts shall be replaced with Stover locknuts if not at least 2 threads protrude through nylon locknut.

Contact your local TESCO Parts and Service Center for further information regarding this bulletin and or supply of affected components noted above.